



eritage Window and Door, Inc.

6141 Casmere, Detroit, MI 48212
Phone (313) 893-2000, FAX (313) 893-2007

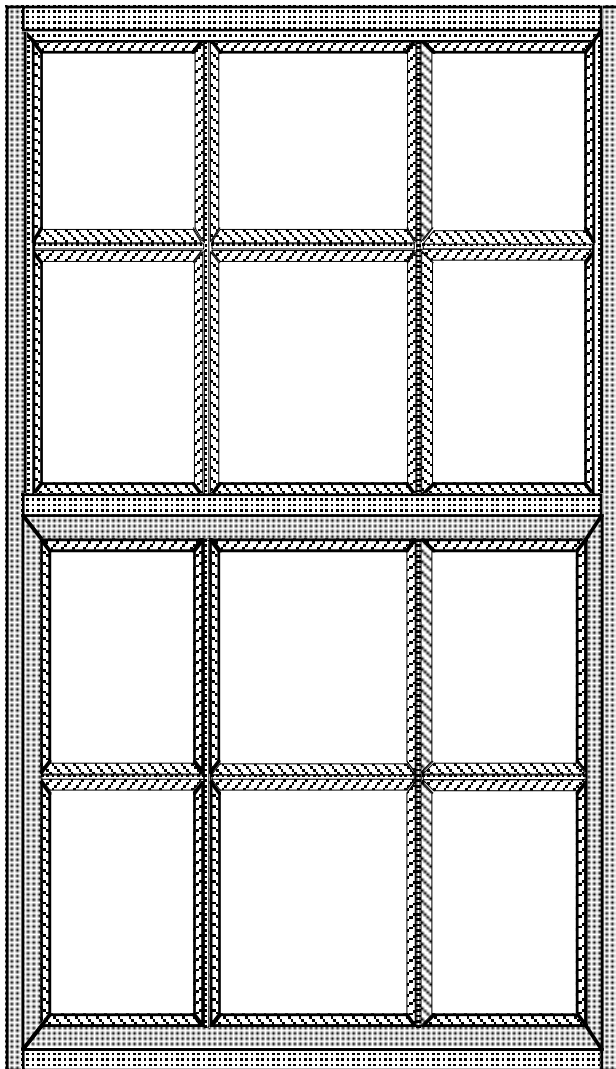

HEAD

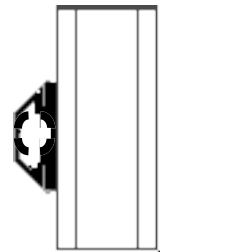

MEETING
RAIL



SILL

CA3115/80
AP-AW65

Thermally Broken, Historic, Projected Vent Window
PRESERVING AMERICA'S WINDOW HERITAGE

MODEL CA3115/80 SPECIFICATIONS

Description

Thermally broken, Monumental, Historic, Projected vent window.

Application

This thermally broken vent is designed to accurately replace steel sash with a modern insulated window .

Special Features

Some of our special features include:

Unique Applied interlocking Muntin system that provide the appearance of old steel muntins with a beveled perimeter to accurately replicate outside putty-glazed steel sash. Flush face construction, screen subframe that prevents exterior removal and obviates the need for wickets on many configurations.

Construction

Nominal wall thickness .125" 6063 T-5 extruded aluminum with integral poured-in-place thermal barrier. All vent members shall be of tubular construction. Vents shall present a flush profile with the mainframe. Vent joinery shall be mitre-cut with hydraulically crimped corner keys, frame joinery shall be butted and coped with stainless steel screws into integral screw ports.

Glazing

Standard: Factory glazed with 1" sealed glass.

Optional: 1/4" glass or 1.5" panel.

1" glass with true muntins available on CA3180

Finishes

This custom product is special order only and is available with Powdercoat paint; anodized or Kynar® finishes.


Hardware

4 bar stainless steel hinges, white bronze cam handles Push or Roto operators available on casements,

Accessories

Panning, trims, receptors and mulls available.

**For more information, contact your Heritage Window and Door, Inc.
sales representative**

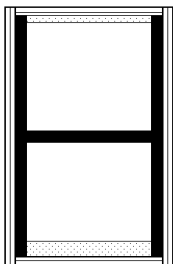

**Heritage Window and Door, Inc.
6141 Casmere, Detroit, MI 48212
Ph (313) 893-2000; FAX (313) 893-2007**